

Classification:

Reference:

Date:

BT01-050

ITB01-076

December 17, 2001

**2001-2002 G20; RIGHT HAND WINDSHIELD DEFROSTER VENT NOT FLUSH
AND/OR MAKING RATTLE NOISE**

APPLIED VEHICLE(S): 2001-2002 G20 (P11)

SERVICE INFORMATION

If an applied vehicle exhibits the following symptom:

- Right hand defroster vent is not flush with the dash panel (right side vent).
- Rattle noise from the right side of the right hand defroster vent (see Figure 1)

Use the Service Procedure in this bulletin to repair the incident if it should occur.

SERVICE PROCEDURE

1. Check if the defroster vent is not flush with the dash panel (right side of vent) and/or there is a rattle noise from the right side (see Figure 1).

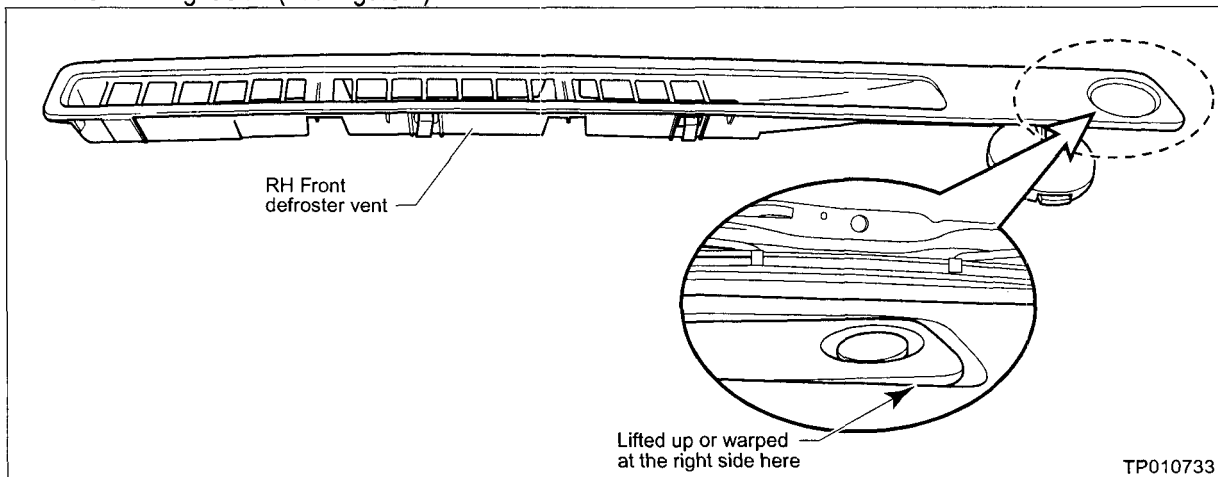


Figure 1

2. Remove the RH defroster vent from the dash panel. Use a suitable prying tool in order not to scratch the finish of the defroster vent and the dash panel.
3. Disconnect the wiring harness from the sun-load sensor.
CAUTION: Do not allow the sun-load sensor wiring harness to fall into the dash panel because it will be difficult to retrieve it.

4. Turn the defroster over and trim the edges of the vent at 2 locations shown. Trim 1mm to 2mm from the edges. See Figure 2 below.

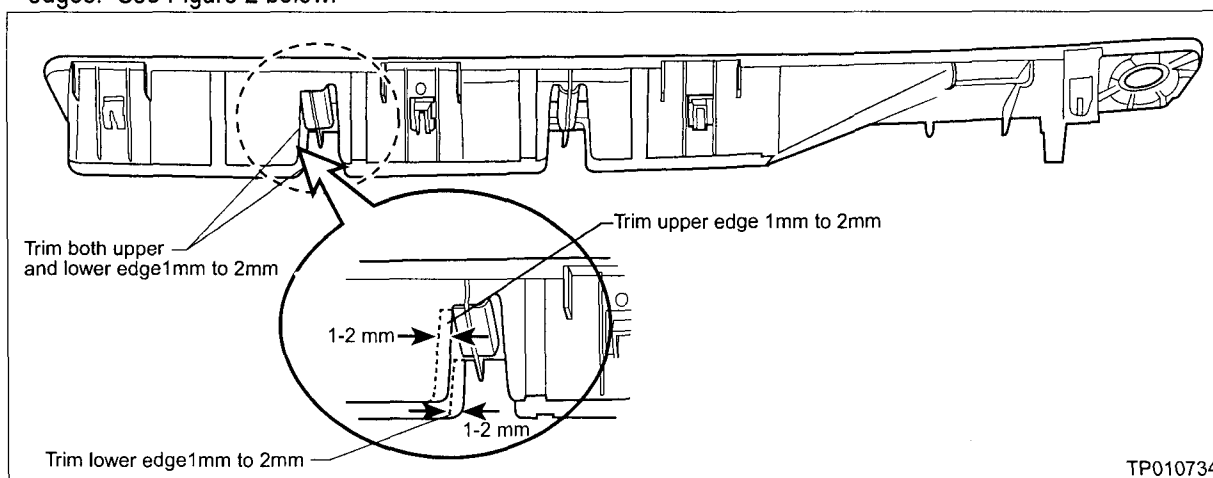


Figure 2-Bottom View

5. Remove the sun-load sensor from the defroster vent and apply a felt cloth tape, P/N 68239-13E00 around the sun-load sensor (see Figure 3)

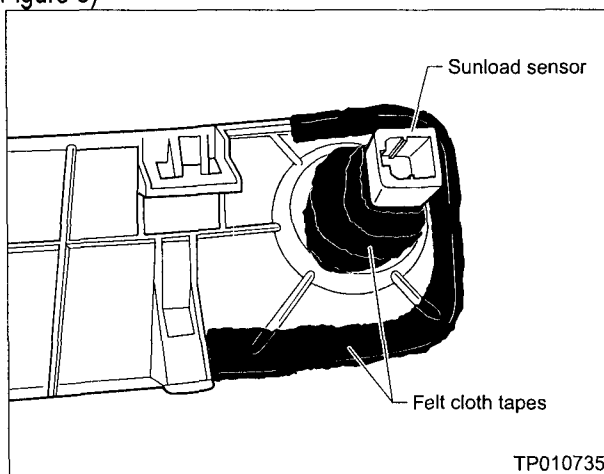


Figure 3-Bottom view

6. Apply felt cloth tape to the right side bottom edge of the defroster vent near the sun-load sensor to prevent rattle noise (see Figure 3 above).
7. Install the sun-load sensor to the defroster vent.
8. Re-connect the wiring harness to the sun-load sensor and install the defroster vent to the dash panel.
9. Confirm the following:
 - Defroster vent is securely attached to the dash panel.
 - The right side of the vent is flush with the dash panel
 - No rattle noise

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
Felt Cloth Tape	68239-13E00	1

NOTE: Claim only the actual portion of the felt used. Reference Nissan Technical Service Bulletin NTB98-110 regarding "Nissan Vehicle Squeak and Rattle Materials" for further details.

CLAIMS INFORMATION

Submit a Primary Operation (PO) line claim using the following claims coding:

DESCRIPTION	OP CODE	SYM	DIA	FRT
Squeak & Rattle Repair – Dashboard, RH (1)	UX0199	ZL	44	(2)

1. Reference Section "UX – Squeak and Rattle Repairs" of the current Nissan Warranty Flat Rate Manual for details.
2. Straight Time operation – claim actual hours
3. Do NOT claim any components/repair materials on this claim – use Expense Code "022" to claim the actual portion of felt tape used. Reference Nissan TSB "BT98-041" regarding "Nissan Vehicle Squeak & Rattle Materials" for further details
